





Discharge Cap Prox Kit 506222 Installation Instructions Quicksheet

Discharge Cap Prox Kit - Assembly Instructions


NOTE: See *Feed Bin Manual & Flexible Auger Manual* for additional assembly instructions and hardware.

1. Premark mounting holes for slots in item 9 and drill (1) 7/8" hole and (2) 11/32" holes into one side of the discharge cap, at the dimensions shown below.

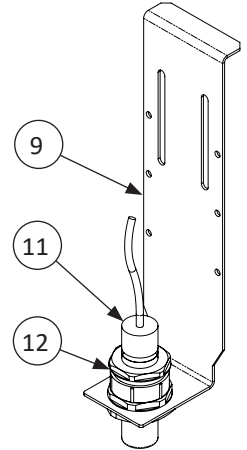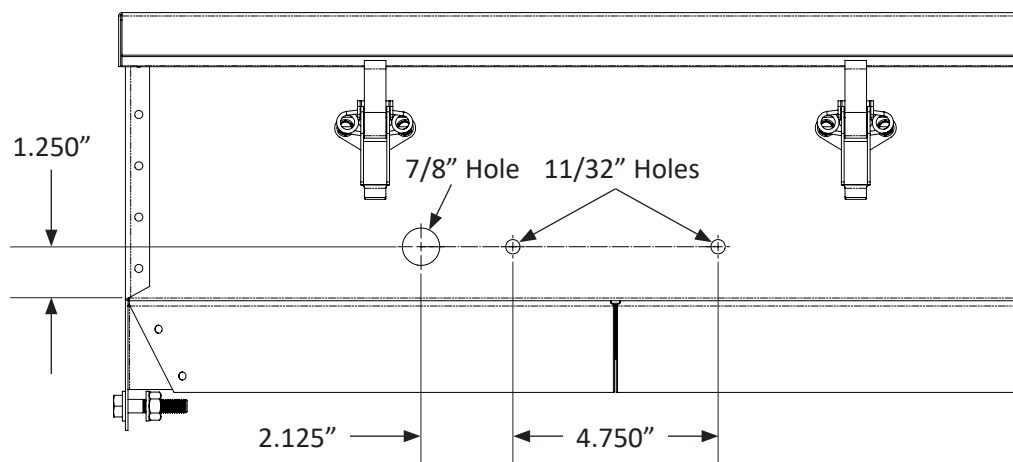


NOTE: Items 9, 11, and 12 arrive pre-assembled from the factory.

2. Fasten pre-assembled items 9, 11, and 12 to item 8 using (2) each of hardware items 2 and 3, as shown in the image to the right.
3. Fasten assembled items 8, 9, 11, and 12 to the (2) $\varnothing.332$ drilled holes in the discharge cap using (2) each of hardware items 1, 2, 4, and 5, as shown in the image to the right.
4. Fasten item 10 to the $\varnothing.866$ drilled hole in the discharge cap using item 7, as shown in the image to the right to complete the assembly.
5. Use supplied cable ties to secure the wire from the Prox Sensor to the holes provided in item 9.

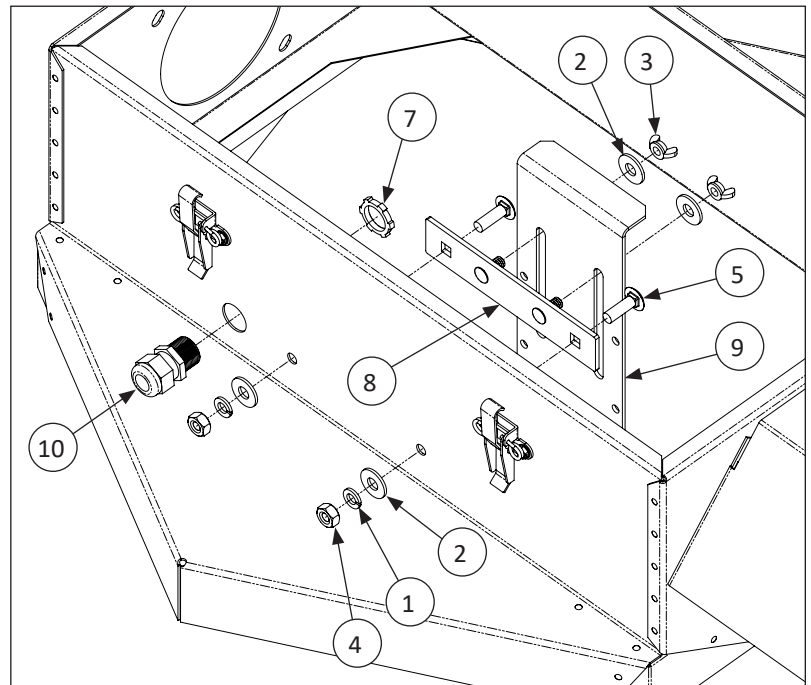

Discharge Cap Prox Kit - Parts List

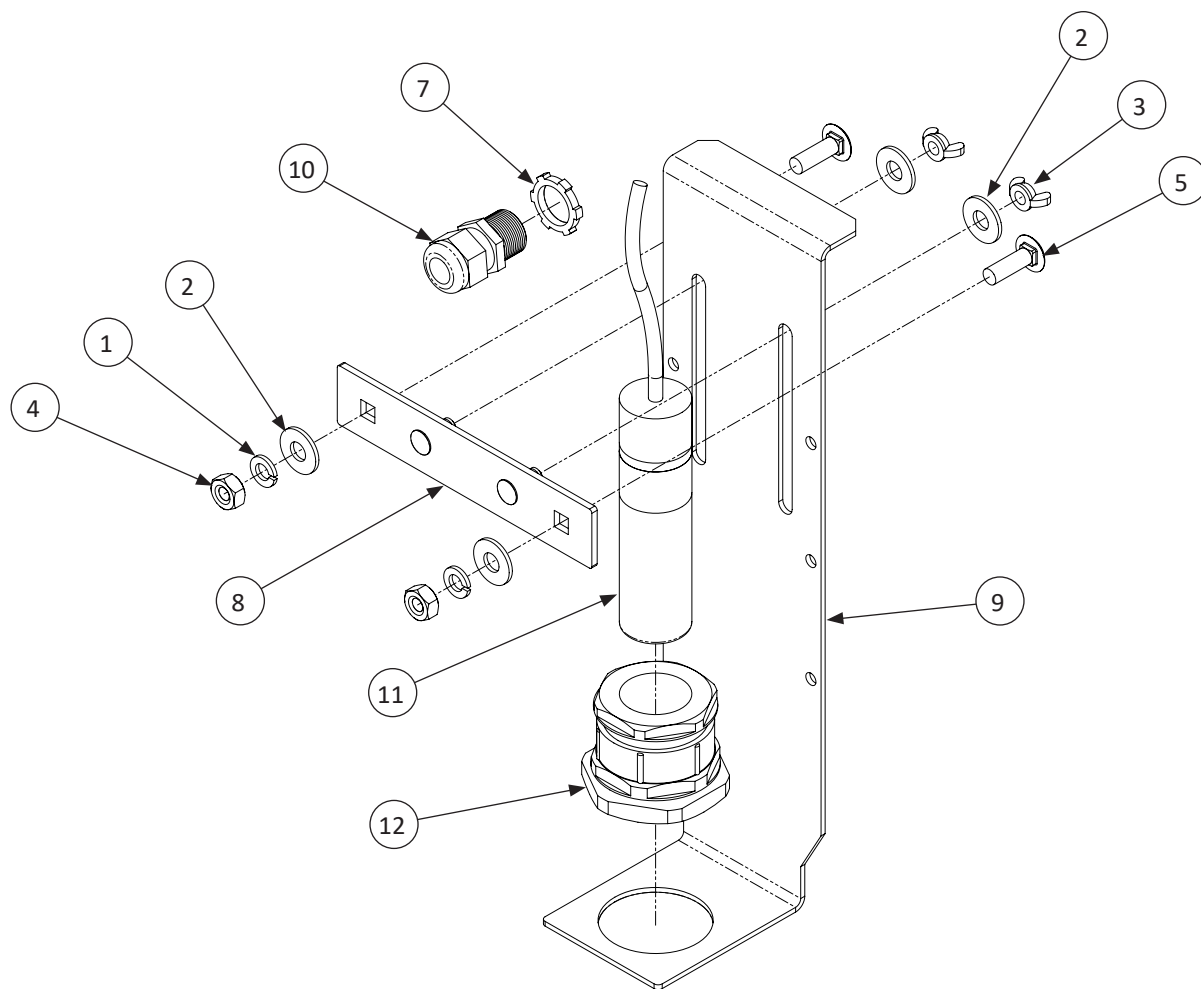

KEY	PART #	DESCRIPTION	QTY
DISCHARGE CAP PROX KIT (506222)			
1	010252	5/16" LOCK WASHER	2
2	010426	5/16" FLAT WASHER	4
3	010944	5/16-18 WING NUT	2
4	011114	5/16-18 HEAVY HEX NUT	2
5	011454	5/16-18 X 1" CARRIAGE BOLT	2
6	012800	NYLON CABLE TIE, 8" LONG X 18" WIDE	2
7	420473	1/2" CONDUIT NUT	1
8	506223	MOUNT BRACKET	1
9	506224	PROX MOUNT BRACKET	1
10	750030	STRAIGHT-THRU GROMMET	1
11	750418	PROX SENSOR, 44R-33, 90-265V	1
12	750419	PLASTIC GLAND FOR SKOV	1

North America:

Phone: 800.99VALCO; 800.998.2526

Fax: 419.678.2200

Email: sales@val-co.com

990407

REV [-]

International:

Phone: (+1) 419.678.8731

Fax: (+1) 419.678.2200

Email: intl.sales@val-co.com